

# Tevo Tarantula i3 3D Printer

I have recently purchased an incredibly cheap 3D printer that supposedly should be quite capable and produce Prints of acceptable quality. The brand name is Tevo, the model is called Tarantula i3. That's because it is one of many Prusia i3 clones.

The printer costs only about \$200 from AliExpress but what you save on money you will have to invest in time. While the assembly manual seems to be improved over earlier versions, it is only nearly complete for about half the build. All of a sudden a lot of details and steps are missing and you have to google around for images of the finished product to figure out what goes where. There are some pretty good assembly videos on Youtube, but following videos definitely takes a lot longer than following a decent assembly manual. Anyway, it was a lot of fun putting the machine together. It somehow reminded me of the days when I as a little boy sat in my parents house in the living room with all the parts of my RC cars laid out, carefully following the instructions to put it together. The Tarantula delivers much of a similar experience, so that's fun, just take your time.

Also it could use some improvement here and there. One of the most annoying shortcomings of the kit is the absence of washers to go on the mounting plates where the rollers are attached to. The simple addition of a washer would help to keep the wheels straight and to keep the nuts from digging into the plexy glass when tightening the assembly. This is something I will modify pretty soon, but first I want to get the printer running in its original state and then continue from there.

I have purchased the model with the standard 20x20cm bed and single extruder. The only optional extra I have purchased is the inductive z-axis sensor to auto-level the bed. The only 3D Printer I played around with so far was the XYZ Printing Da Vinci 1.0 which was everything but a joy when it came to levelling the bed. And having your bed level or compensated is very important to get a decent print quality from the first layer on, so I decided I'd get this option to save some time.

Despite owning that XYZ Printer for some years now I still consider myself a novice to 3D printing as I have used it very rarely. It was quite frustrating to spend more time getting the printer calibrated and set up than I spent time printing or designing things to print. Also I was a complete novice to CAD which meant it took forever to come up with my own designs.

## Assembly

I won't write anything about the assembly here except for this: search on youtube for Tevo tarantula assembly videos. There are good tutorials that will help you and plan to spend about 12 hours on your first one. The second will probably be a lot faster, as most of that time goes into figuring out what goes where and which way around :) you can do the first half of the assembly by just following the included manual but from then on you need to google and research

## Axis

Just to get this clear right up front: everybody talks about X Y and Z axis. But which is which? The X axis is the one where the extruder is attached. When you look at your printer from the front it is the axis that moves left to right.

The Y axis is the one on which the printbed moves, so from front to back

And Finally the Z axis is up and down.

The 0,0,0 point on my printer is in the front left corner of my bed, so the X axis all the way to the left, The print bed all the way to the back and the Z axis touching the bed.

## Modifications


### Fan Duct

the biggest let-down of the tevo in my eyes is the fact that there is not sufficient layer cooling. this results in poor print quality giving everything a pretty melted look. I printed the [LPA Fanduct v5](#) which seems to have a pretty good aerodynamic design allowing a single 40mm fan to cool the print excellently. this led to a huge improvement of print quality. Also the fanduct includes a mount for both the SN-05N contact-less bed leveling sensor as well as the BLTouch sensor which i converted to after a few prints

### Bed Leveling Sensor

I first ordered my Tevo with the contact-less SN-05N sensor. however i noticed that the sensor needs to be quite close to the print bed in order to detect it and this turned out to be a problem with the offset it has from the print-head in my setup (with the above fanduct. If you mount the sensor too high it will not detect the bed before the filament nozzle hits the bed which leads to the nozzle crashing into your bed and then pushing it down violently as the sensor will never detect the bed in such a case. If you mount it too low it will mess up your prints as it will hit your latest layer. combine this with a slight wrapping of a print and you have a disaster. The problem is, that due to the low range, the gap between too high and too low is very narrow (less than a mm). this means, that if you have a large offset from the printhead (which is the case with most cooling fan setups that distribute the air 360° around the nozzle) your bed needs to be almost perfectly leveled or you risk for the sensor to be too high and too low at the same time, depending on the corner you are measuring in. Last but not least, the tevo's print bed may warp slightly which is why i would like to try to print on a mirror or glass in the future and i would also like to experiment with a print plate that would make it easy to release the print from the surface later on. both these methods increase the distance between the nozzle at 0mm altitude and the metal print bed which won't work with the SN-05N sensor.

For all these reasons I quickly decided to switch to a BLTouch sensor. I ended up ordering a clone called [TLTouch](#). Wiring to your tevo tarantula might be different from mine, depending on the controller version you have. I got mine with the MKS Base v1.4 board, thats the one with the blue,red,yellow and white sockets on it.

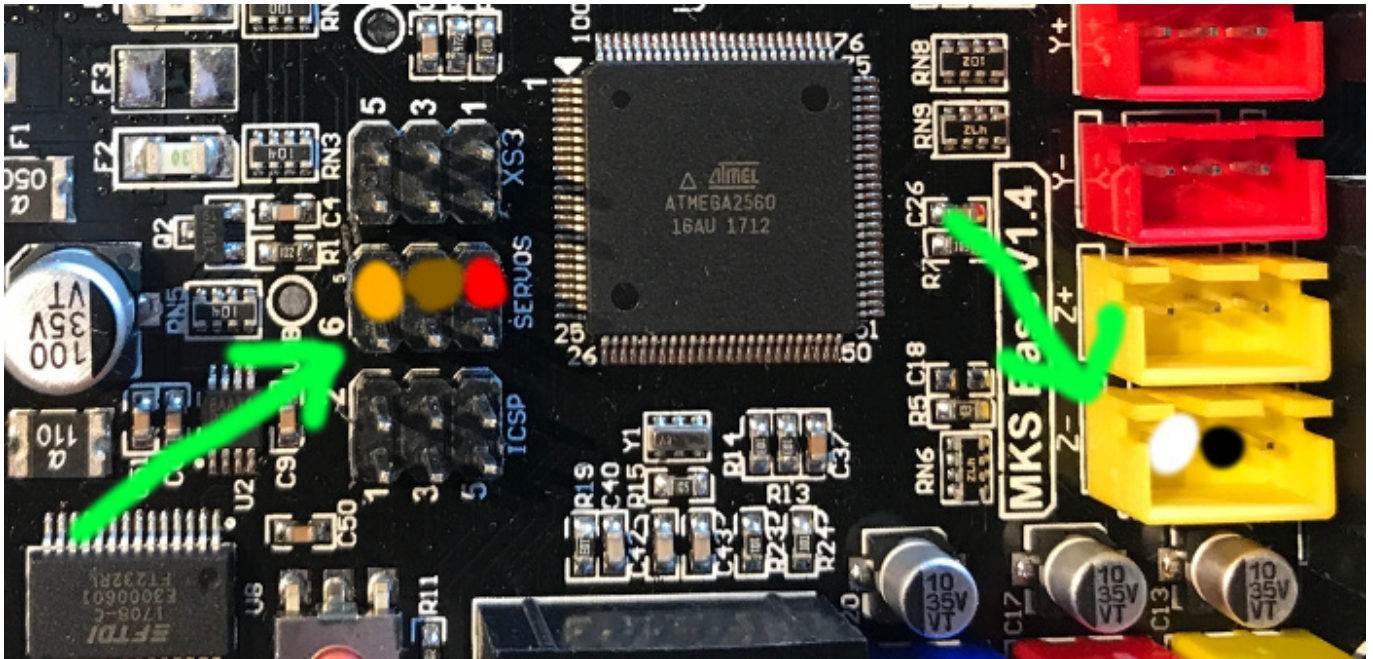

connect the BLTouch to the two sockets where the green arrows point to. Orange is S(ignal) pin, Brown is GND, Red is 5V, White is ZMIN and Black again GND. These are the labels you can see on the BLTouch sensor.

if you have an older board, you might find the wiring here:

<http://mon.im/2016/06/tevo-tarantula-bltouch-setup.html>

## BLTouch Settings

set these settings (search for them, they are already in the Configuration.h file, then modify or uncomment what you need) The offsets are for the LPA v5 fanduct, luckily they provide them in the documentation.

```
#define Z_MIN_PROBE_ENDSTOP_INVERTING false
#define BLTOUCH
#define X_PROBE_OFFSET_FROM_EXTRUDER 39 // X offset: -left +right [of the
nozzle]
#define Y_PROBE_OFFSET_FROM_EXTRUDER -42 // Y offset: -front +behind [the
nozzle]
#define Z_PROBE_OFFSET_FROM_EXTRUDER 0 // Z offset: -below +above [the
nozzle]
#define X_MIN_POS 0
#define Y_MIN_POS 42
```

## Firmware Setup

Since I have the Auto Level option I had to dig into how to calibrate that thing right away as the auto homing will cause the Z axis to crash into the printing bed with the standard firmware configuration. I decided to get the newest [Marlin Firmware](#) and go from there. What you essentially need is the Configuration.h and Configuration\_adv.h files that contain the parameters for a Tarantula in your

configuration and then you can start from there to tweak the settings.

## Compiling and Flashing

that's quite easy: just download the latest Arduino IDE and install it. a little warning here, the one included in the Ubuntu Repos is very old.. for Ubuntu 17.04 there was still a version 1.0.x of the arduino IDE, Marlin currently needs at least 1.6.x to work and you currently can download 1.8.3 from the Arduino webpage. then double check that your control board has the Atmel 2650 chip on it and select the board accordingly in the Arduino IDE. now you can simply open the Marlin.ino file, change your config settings and hit upload.

## Settings

I will upload my config here once i got it all working, so you can simply compare my settings with yours, and i will explain some parameters below i had some difficulty to understand or to get right

## Auto Bed Leveling

There are many options as to how the auto bed leveling should work. I went with the Bilinear option which will just check 4 corners and then calculate the bed surface. As for my probe i selected a `FIX_MOUNTED_PROBE` which is what I have.

## to EEPROM or not to EEPROM

in quite a few configs i found it was recommended to disable the EEPROM. The EEPROM will be used to store some settings on the controller without hardcoding them into the firmware. When developing firmware, it might certainly be great to disable the EEPROM as you won't have to deal with clearing it while you make adjustments to the hardcoded settings. However, in order to get some of the parameters right it might be easier if you can adjust those via some Gcode commands or the display and then copy your final results into your firmware configuration.h file for the final upload. also it seems that some settings are not available in the configuration file, at least i didn't find them there. So i recommend turning the EEPROM on and using it to help you get your settings done.

## Sensor Offsets

The endstops for the X Y and Z axis are not mounted at the 0,0,0 point of my printer, they are mounted at a certain offset. So when the bed moves all the way back it will hit the Y limit switch but by that time, the Extruder will be 40mm off the bed. There are two solutions to that: Mechanically you could move your end switch forward so that it hits the bed when it reaches its Y=0 position or you can adjust the offset by Software. Some people do it one way, some the other, that's why you will always need to fiddle with this setting when you take someone's config files and start from there. When I assembled my Tevo i didn't dive right into getting the software set up due to a lack of time, so it was sitting around for a month or two. by the time got started with the software setup i had forgotten that i could move that Y axis endstop so i solved it by adjusting my software and only now i realized i could

have adjusted that enstop :)

So for the homing to work when your endstops are at the physical end of the axis and not at the logical 0 points, you need to configure the probe offsets. here are mine:

```
#define X_PROBE_OFFSET_FROM_EXTRUDER 39 // X offset: -left +right [of the nozzle]
#define Y_PROBE_OFFSET_FROM_EXTRUDER -42 // Y offset: -front +behind [the nozzle]
#define Z_PROBE_OFFSET_FROM_EXTRUDER 0 // Z offset: -below +above [the nozzle]
```

As you can see here, my Y endstop is 40 mm behind the actual 0 point.

## X Y Z Axis positions

The problem is, that the probe offsets above are not automatically taken into consideration to calculate the travel limits and the offset for Axis positions relative to the endstops.

There is a [Wiki article in the Marlin Wiki](#) describing how to set your Axis positions correctly. While I agree with the Author, that Method 1 (hardcode everything in the firmware) is the best solution, I couldn't figure out the right parameters to do so! What worked for me in the end was Method two which requires setting some offsets in the firmware. Hence we need to enable EEPROM for this.

So here is what I set in my config file:

```
#define X_MIN_POS 0
#define Y_MIN_POS 42
#define Z_MIN_POS -1
#define X_MAX_POS X_BED_SIZE
#define Y_MAX_POS ( Y_BED_SIZE + Y_MIN_POS )
#define Z_MAX_POS 200
```

But this alone seems to be not enough. what happens with this setting is, that now my Y axis will move to the 0 position when I send a G1 Y0 command (this means, move the y axis to 0). So far so good, but when I send G1 Y20 I would expect to move now 20mm away from the 0 point, but unfortunately nothing will happen until I move further than 40 away from 0. only then my bed will start moving. So in order to reach the Y=200 (the rear end of the bed) I have to send G1 Y240 which needs to be fixed.

so far I don't know where in the Configuration.h file I could fix that, the only possibility I have found is by programming the Offset into the EEPROM by running this G-code:

```
M206 X0 Y-42 Z0
M500
```

the first line is to set the X offset to 0 and the y offset to -40, the second line is simply to store this to eeprom.

now my coordinates work, when I move the printer to Y=5 it moves 5mm to the back :)

## Setting the Z Axis Sensor offset

In order to get the first layer to a) stick to the bed and b) not be too flat the Z axis needs to have a very precise 0 point. However, the Z probe usually needs some fiddling until it is mounted correctly so that it won't interfere with your print but still reach the print bed before the nozzle does. So the only viable option is, to configure this in the firmware. Again we will use the eeprom to save that setting. Here it even makes sense, because every time you remove that sensor, i.e. after you have printed the fan duct and mounted it, you will need to play around and adjust this setting.

In order to adjust the Z axis, i first sent G28 to auto home all axis, then G29 to autolevel the bed, i then used G1 Z0 to move the Z axis to the 0 position. I put a sheet of paper under the Nozzle and gently lowered it in 0.1mm steps in order to touch the paper. In case you can't lower the Z axis enough, you might need to set the Probe Z-Offset using

```
M851 Z-3.1
```

this sets the offset to -4 and therefore allows you to go 4mm lower with the Z axis. once you feel some resistance on the paper, pull it out from underneath the nozzle and make sure the bed does not hit the nozzle when the paper is removed, otherwise you where too low already. once you get the offset right, use again M206 to set it:

```
M206 Z0.2  
M500
```

will set the z offset to 0.2mm LOWER than the sensor's indication was.

Now make sure that your Slicer adds these Gcodes to the beginning of every job, to make sure your bed leveling has been done:

```
G28 ; auto home  
G29 ; auto bed level
```

Now print something and see if you are happy with your first layers

First set the Z probe offset to 0 and run Auto Home and Auto bed level

```
M851 Z0  
G28 ; auto home  
G29 ; auto bed level
```

now jump to the first auto bed level coordinate that was probed but keep the Z axis above 0

```
G1 X50 G1 Y0 G1 Z10
```

Hold a piece between the extruder nozzle and the printbed and slowly lower your Z axis until the extruder touches the paper and you can feel some resistance..

```
G1 Z-0.1  
G1 Z-0.2
```

.....

In case you can't lower the Z axis any further, use the last offset that worked and enter it as your z probe offset. i.e. lets say you could get to

```
G1 Z-2
```

set the offset to -2 and auto home again to apply the offset:

```
M851 Z-2  
G28
```

then try again. if you still can't reach the bed, add your last working offset to the one you have set and set it as the new offset.. so let's say you made it to -2 again but did not yet touch the bed, then you would set your offset now to M851 Z-4. once you have made contact with the paper, remove it and slide it back in. if you can't slide it back in, raise your nozzle slightly as it is now probably already pushing down on the bed and we don't want that, it should just lightly touch it.

once you have determined the negative Z position, add this to your last set offset and set it as your new offset. let's say you have had to iterate twice with a offset of -2 and you added another -1.3 to get to the paper, you can now set and store your new offset of -5.3 like this:

```
M851 Z-5.3  
M500
```

Send your Z axis again away from the printbed using

```
G1 Z10
```

and you are ready to send your first printjob :)

by the way, you can also set this offset in the marlin menu under Control->Motion->Z Offset

## Slicer Software and Settings

I decided to buy Simplify3D as i find it quite comfortable.

From:  
<http://wiki.psuter.ch/> - **pswiki**

Permanent link:  
[http://wiki.psuter.ch/doku.php?id=tevo\\_tarantula\\_i3\\_3d\\_printer&rev=1521380708](http://wiki.psuter.ch/doku.php?id=tevo_tarantula_i3_3d_printer&rev=1521380708)

Last update: **18.03.2018 14:45**

